

Magnetic Particle Accessories

Magnetic Particle Equipment Cables, Adapters and Accessories

Adapters and add-on accessories expand the capabilities of standard magnetic particle equipment. Every application has unique requirements, and these specially designed adapters make magnetization easier.



CABLES

4/0 cables are essential for P-series, M-series, and CSV-series power packs. Cables can be used to flow magnetizing current through a large part or structure, or wrapped around pipes and long weldments for longitudinal magnetization. Magnaflux 4/0 cables are available in standard welding grade or heavy-duty grade with extra insulation and tinned conductors. Cables are factory terminated in a variety of lengths and a choice of standard lug connections or heavy-duty quick connect fittings. Custom-length cables are also available – please contact Magnaflux Customer Service for quotation.

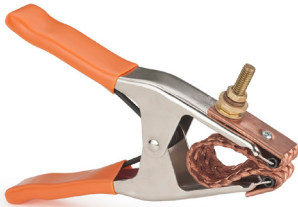
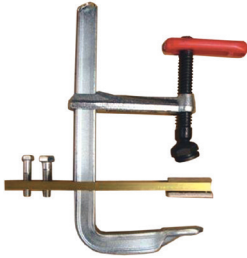
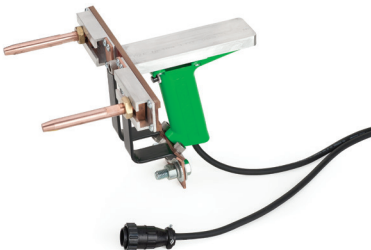
Cable	Description	Length	Part number
Standard 4/0 	4/0 cable assembly with two 626342 lug connectors on each end	15 ft / 4.6 m	626350-180
		20 ft / 6.1 m	626350-240
		Custom length	626350-xxx Contact customer service
Standard 4/0 	4/0 cable assembly with 628828 QC-F and 628829 QC-M quick connectors on each end	15 ft / 4.6 m	628833-180
		20 ft / 6.1 m	628833-240
		Custom length	628833-xxx Contact customer service
Heavy-Duty 4/0 	Lug to Lug	Custom length	626500-xxx Contact customer service

Connector	Description	Part number
4/0 Lug 	Standard 4/0 cable termination	626342
QC-M 	Male Quick connect 4/0 cable termination (used with QC-F)	628829
QC-F 	Female Quick connect 4/0 cable termination (used with QC-M)	628828

Adapter	Description	Part number
Lug-QC Adapter Kit 	Set of two adapters, 12 in / 30 cm long. Standard 4/0 lug to QC-M and Standard 4/0 lug to QC-F, one each. Used in combination with prods, connectors and cable wraps to provide modularity in magnetizing techniques.	628832

PRODS & CONNECTORS

When using P-series, M-series, and CSV-series power packs, effective magnetization depends on secure contact with the part or structure being examined. Connections can be made in a variety of ways depending on the specific needs of the application.

Connector	Description	Part number
Standard Contact Clamp 	Spring-loaded clamp with braided copper contact and lug connection. Used for smaller structures and parts up to 2.5 in / 6.4 cm diameter.	Clamp: 1865A Replacement copper braid: 14710
Heavy-Duty Contact Clamp 	Large C-Clamp with leaded copper braid contact pad and double lug connections. Used for large structures and parts up to 7 in / 18 cm diameter.	169802
Standard Prod Set 	Set of two hand-held electrodes with mag shot trigger and 4/0 lug connections. Solid copper tips 0.375 in / 9.5 mm diameter, 3.75 in / 95 mm long.	P-Series: 157662 M-Series: 622088
Dual Prod Set 	Single hand-held set with two electrodes, mag shot trigger and 4/0 lug connections. Adjustable electrode spacing with 3.875-8.125 in / 9.8-20.6 cm range. Solid copper tips 0.375 in / 9.5 mm diameter, 3.75 in / 95 mm long.	P-Series: 157781 M-Series: 622499

WET BENCH ADAPTERS

Expand the capabilities of standard wet bench equipment for examination of multiple small parts or large structures. These adapters maximize the number of parts that can be inspected using a single piece of equipment.

Adapter	Description	Part number
Central Conductor Kit 	Solid copper rods 18 in / 45.7 cm long for circular magnetization (head shot) of rings and hollow parts. Set of three diameters: 0.50 in / 12.7 mm, 0.75 in / 19.0 mm, 1.00 in / 25.4 mm	622639
Small Parts Adapters 	Copper contact blocks mounting directly to the head and tail stock providing small contacts (1.00 x 1.25 in / 25.4 x 31.8 mm) for direct magnetization of small components. Adjustable V-block for pins and bolts.	Headstock: 28470 Tailstock: 28471
Flat Coil 	Sealed lateral coil, mounts between head and tail stock to provide indirect magnetization. Wide flat surface for inspection of multiple small components. Parts can be arranged in line for circular magnetization or across the coil for longitudinal magnetization. 20 in / 51 cm long, 6.75 in / 17 cm wide, 44 Lb / 20 kg. Includes two handles for loading and unloading.	611700
Steady Rests 	Single hand-held set with two isolated rollers that mount directly to the equipment to stabilize and support long, heavy parts such as crankshafts during the inspection process. Adjustable height to accommodate different shaft diameters. Capacity up to 1500 Lb / 630 kg.	Headstock: 605750 Tailstock: 621658 Rail-Mount: 1857
Contact Block 	Adapter clamped between head and tail stock provides lug terminals to connect 4/0 cables for remote magnetization.	Headstock: 1830

REMOTE CONTROLS

Remote control cables for P-Series and M-Series power packs allow the inspector to trigger mag shots and adjust amperage settings at the examination site.

Remote	Description	Part number
P-Series Remote 	Remote switch for triggering a mag shot, 15 ft / 4.6 m long.	626797
Remote Palm Button 	Remote mag shot button for use with the Mag Kit and P-Series power packs. Mounts directly to the side of the Mag Kit bench.	169621
M-Series Pendant 	Remote control box provides full control of M-Series power pack at the examination site. Includes waveform selection, amperage adjustment, and mag/demag triggers. 15 ft / 4.6 m long.	626120

DISTRIBUÉ PAR / DISTRIBUTED BY:



QUEBEC

164, St-Jean-Baptiste
Mercier, QC J6R 2C2
T : (450) 691-9090

ONTARIO

275 Sheldon Drive, Unit 3
Cambridge, ON N1T 1A3
T : (519) 894-9069

www.qnde.ca